


K50APPBGYCQP Pick-to-Light – Placement Sensor



Technical data

K50APPBGYCQP
3032094
Pick-to-Light
Pushbutton
Momentary
Green, Permanently on
Yellow
Wash down
1230 VDC
≤ 150 mA
75 mA
NO contact, PNP
PNP
< 3 ms
Dome, K50
Ø 50 x 63.7 mm
Plastic, PC Thermoplastic material, Black
Polycarbonate, diffuse
Cable with connector, M12 × 1, 0.15 m, PVC
4
4 -40+50 °C

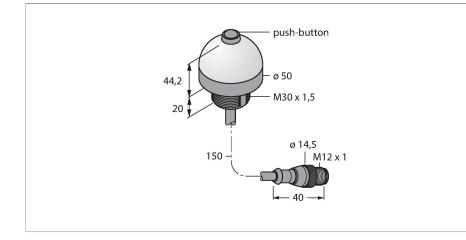


Features


Protection class IP67
Cable with male end M12 x 1, 4-pin, 150 mm
Job light: green
Mispick: not signalled

- Actuation: yellow
- Operating voltage 12...30 VDC
- PNP switching

NO contact

Wiring diagram





Functional principle

The K50 pick-and-place sensor is suitable for many mounting and component placement applications. The green work light or other signal lights are reflected perfectly by the entire dome (depending on the version). The transistor output can be easily connected to a system control, which is programmed for a special task sequence. The work light of the sensor is located in or next to every bin at the operator's workstation and indicates: 1. The bins with the components to be picked up for a particular work step and 2. the sequence in which the components have to be picked up. If the operator removes




Technical data

Protection class	IP67 IP69
Tests/approvals	
MTTF	146 years acc. to SN 29500 (Ed. 99) 40 °C
Approvals	CE


a part from the bin, the K50 detects the hand in the bin and sends a signal to the control unit. The system then checks if the correct component has been picked up and - depending on the configuration - switches the corresponding work light off and the next one on, according to the assembly sequence. The work sequence control leads to increased efficiency, improved quality control and reduces rework and testing expenses. The term work light therefore refers to the visual indicator of the bin from which a part should be removed next. The actuation indicator confirms the removal with a different color. The mispick indicator illuminates if a bin was reached into when the work light was not set.

Accessories

SMB30A



3032723 Mounting bracket, rectangular, stainless steel, for sensors with 30mm thread




SMB30SC

3052521

Mounting bracket, PBT black, for sensors with 30 mm thread, rotatable



3074005 Montagewinkel; Werkstoff VA 1.4401

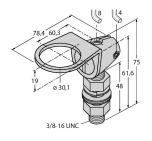

Accessories

